

MULTIMETER AND CLAMP METER



People Electric
Appliance serves for people.



Rohs CB



ISO9001 ISO14001 OHSAS18001



中国·人民电器集团
PEOPLE ELE. APPLIANCE GROUP CHINA

MULTIMETER

MULTIMETER



YX360TRES

- Mirrored 3 color scale for easy reading
- 18 ranges and 4K Ω/V DC/AC sensitivity
- Battery check function
- Fuse and diode protection
- Recessed input terminals for safe use

Accessories:

Test lead, battery[6F22(9V)x1, AA(1.5V)x2], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	0.25-10-50-250-500-1000V	$\pm 3.0\%$
ACV	10-50-250-500-1000V	$\pm 5.0\%$
DCA	0.25m-2.5m-25m-250mA	$\pm 3.0\%$
OHM	2K-20K-2M Ω	$\pm 3.0\%$
Batt	1.5V	
Size/Weight	125x85x35mm/150g	



YX360TRN

- A large and bright meter with a scale lengthly of 80mm and its sensitivity of 44* A at full scale
- Excellent DC resolution factor of 2mV and expanded resistance measurement from 0.2 Ω ~20m Ω
- Fuse and diode protection

Accessories:

Test lead, battery[6F22(9V)x1, AA(1.5V)x2], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	0.1-0.25-2.5-10-50-250-1000V	$\pm 3.0\%$
ACV	10-50-250-1000V	$\pm 4.0\%$
DCA	50 μ -2.5m-25m-0.25A	$\pm 3.0\%$
OHM	2K-20K-200K-2M-2M Ω	$\pm 3.0\%$
L1	150 μ -1.5m-15m-150mA	
dB	-10dB~+62dB	
hFE	0~1000	
Size/Weight	160x128x41mm/320g	



SUNS30 SERIES

Display:	
suns30, suns31	Digital 2400 counts, updates 3/sec
suns32-suns37	Digital 1900 counts, updates 3/sec
Operating Temp	-50 $^{\circ}$ C~1000 $^{\circ}$ C
Storage Temp	-50 $^{\circ}$ C~1000 $^{\circ}$ C
Battery Type:	
suns30, suns31	1.5Vx2 AAA R03 SUM-4
suns32-suns37	6F22 9Vx1
Continuity Beeper	2700Hz
Size(HxWxL)	3.9cmx7.0cmx15.5cm
Weight	About 230g
Safety	600V CATII

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	250mV-600V	$\pm 0.8\%$
ACV	2.4V-600V	$\pm 1.5\%$
DCA	240 μ A-10A	$\pm 1.2\%$
ACA	240 μ A-10A	$\pm 1.5\%$
OHM	240 Ω -24M Ω	$\pm 1.0\%$
CAP	250nF-25 μ F(only for suns 31)	$\pm 3.0\%$
Hz	50Hz-50MHz	$\pm 1.5\%$



YX1000A

- Pocket size and weight
- Easy to read 3 colour scale
- Recessed safety input terminals

Accessories:

Test lead, battery [AA(1.5V)x1], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	0-10-50-250-1000V	$\pm 3.0\%$
ACV	0-10-50-250-1000V	$\pm 5.0\%$
DCA	0-0.5-50-500mA	$\pm 3.0\%$
OHM	Rx10, Rx100, Rx1K	$\pm 3.0\%$
Size/Weight	100x64x32mm/80g	



YX360TRD

- A large and bright meter with a scale lengthly of 80mm and its sensitivity of 44* A, at full scale
- Excellent DC resolution factor of 2mV and expanded resistance measurement from 0.2 Ω ~20m Ω
- Fuse and diode protection

Accessories:

Test lead, battery [6F22 (9V)x1, AA(1.5V)x2], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	0.1-0.25-2.5-10-50-250V	$\pm 3.0\%$
ACV	10-50-250V	$\pm 4.0\%$
DCA	50 μ -2.5m-25m-0.25A	$\pm 3.0\%$
OHM	2K-20K-2M Ω	$\pm 3.0\%$
L1	150 μ -1.5m-15m-150mA	
dB	-10dB~+62dB	
CAP	10 μ F	
hFE	0~1000	
Size/Weight	160x128x41mm/320g	



中国·人民电器集团
PEOPLE ELE. APPLIANCE GROUP CHINA

MULTIMETER

MULTIMETER



ECS820B

- 3 1/2digits LCD with a Max. Reading of 1999
- Data-hold function
- Low battery indication
- Overload protection

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual



DT830A

- 3 1/2digits LCD with a Max. Reading of 1999
- Low battery indication
- Battery check function
- Overload protection

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual



DT830B

- 3 1/2digits LCD with a Max. Reading of 1999
- Low battery indication
- Overload protection

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual



DT830D

- 3 1/2digits LCD with a Max. Reading of 1999
- Data-hold function
- Low battery indication
- Overload protection
- Audible continuity

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual



DT838

- 3 1/2digits LCD with a Max. Reading of 1999
- Data-hold function
- Low battery indication
- Overload protection

Accessories:

Test lead, temp. Probe, battery[6F22(9V)x1], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2m-20-200-600V	±0.8%
ACV	200-600V	±1.2%
DCA	200 μ -2m-20m-200mA-10A	±1.5%
OHM	200-2K-20K-200K-2M Ω	±1.0%
Diode Check	2.8V/1mA	
hFE	Vce 3V, Ib 10 μ A	
Size/Weight	137x69x31 mm/163g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2000m-20-200-1000V	±0.8%
ACV	200-750V	±1.5%
DCA	200 μ -20m-200mA	±1.2%
OHM	200-2000-20K-200K-2000K Ω	±1.0%
Diode Check	2.8V/1mA	
Battery Check	1.5V, 9V	
Size/Weight	126x70x28 mm/155g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2000m-20-200-1000V	±0.8%
ACV	200-750V	±1.5%
DCA	200 μ -2000 μ -20m-200mA-10A	±1.2%
OHM	200-2000-20K-200K-2000K Ω	±1.0%
Diode Check	3V/0.8mA	
hFE	Vce 3V, Ib 10 μ A	
Size/Weight	126x70x28 mm/137g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2000m-20-200-1000V	±0.8%
ACV	200-750V	±1.5%
DCA	200 μ -20m-200mA-10A	±1.2%
OHM	200-2K-20K-200K-2000K Ω	±1.0%
Diode Check	3V/0.8mA	
hFE Test	Vce 3V, Ib 10 μ A	
Signal Output	50Hz Square	
Size/Weight	126x70x28 mm/137g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2000m-20-200-1000V	±0.8%
ACV	200-750V	±1.5%
DCA	200 μ -20m-200mA-10A	±1.2%
OHM	200-2000-20K-200K-2000K Ω	±1.0%
Temperature	-20 °C ~1370 °C	
Diode Check	2.8V/1mA	
hFE	Vce 3V, Ib 10 μ A	
Size/Weight	126x70x28 mm/137g	



中国·人民电器集团
PEOPLE ELE. APPLIANCE GROUP CHINA

MULTIMETER

MULTIMETER



DT820D

- 3 1/2digits LCD with a Max. Reading of 1999
- Data-hold function
- Low battery indication
- Overload protection

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual



EC5308

- 3 1/2digits LCD with a Max. Reading of 1999
- Battery test function
- Overload protection

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual



DT920B

- 3 1/2digits LCD with a Max. Reading of 1999
- Pocket digital multimeter
- Overload protection

Accessories:

Test lead, battery [23A(12V)x1], instruction manual



DT810D

- 3 1/2digits LCD with a Max. Reading of 1999
- Battery check function
- Overload protection
- Audible continuity

Accessories:

Test lead, battery [23A(12V)x1], instruction manual



DT830B+

- 3 1/2digits LCD with a Max. Reading of 1999
- Data-hold function
- Low battery indication
- Overload protection
- Audible continuity

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2000m-20-200-1000V	±0.8%
ACV	200-750V	±1.5%
DCA	200 μ -20m-200mA-10A	±1.2%
OHM	200-2K-20K-200K-2000K Ω	±1.0%
Diode Check	3V/0.8mA	
hFE Test	Vce 3V, Ib 10 μ A	
Signal Output	50Hz Square	
Size/Weight	128x70x28 mm/137g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	2-20-200-1000V	±0.8%
ACV	200-500V	±1.5%
DCA	2m-20m-200mA-10A	±1.2%
OHM	200-2K-20K-200K-2K Ω	±1.5%
Diode Check	3V/0.8mA	
Batt	1.5V, 9V	
Size/Weight	128x72x31 mm/136g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	2-20-200-450V	±1.0%
ACV	200-500V	±1.8%
DCA	200mA	±1.0%
OHM	2K-20K-200K-2000K Ω	±1.2%
Diode Check	3V/0.8mA	
Size/Weight	112x62x23 mm/96g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	2-20-200-1000V	±0.8%
ACV	200-500V	±1.5%
DCA	2m-20m-200mA-10A	±1.2%
OHM	200-2K-20K-200K-2K Ω	±1.0%
Diode Check	3V/0.8mA	
Batt	1.5V, 9V	
hFE	Vce3V, Ib 10 μ V	
Size/Weight	100x50x23mm/60g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	2000m-20-200-500V	±0.8%
ACV	200-500V	±1.5%
DCA	200mA	±1.2%
OHM	2000-20K-200K-2000K Ω	±1.0%
Diode Check	1.5V, 9V	
hFE Test	2.8V/0.8mA	
Signal Output	Vce3V, Ib 10 μ A	
Size/Weight	125x75x20mm/145g	



中国·人民电器集团
PEOPLE ELE. APPLIANCE GROUP CHINA

MULTIMETER

MULTIMETER



SUNS17

- 3 3/4digits LCD with a Max. Reading of 3999
- Low battery indication
- Overload protection
- Safety 500V CAT II

Accessories:

Test lead, battery [AAAR03 Daum-4(1.5V)x2], instruction manual

MY60



- 3 1/2digits LCD with a Max. Reading of 9999
- Engineering unit annunciators
- Low battery indication
- Overload protection
- Audible continuity

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual

EC890B+



- 3 1/2digits LCD with a Max. Reading of 9999
- Low battery indication
- Measuring capacitance
- Overload protection
- Audible continuity

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual

MY99



- Digits LCD with a Max. Reading of 4000
- Banging method: Auto/manual
- Low battery indication
- Overload protection
- Audible continuity
- Red button
- Duly selecting button
- Auto power off

Accessories:

Test lead, battery [AAA(1.5V)x2], instruction manual

EC1000



- 4 1/2digits LCD with a Max. Reading of 19999
- Engineering unit annunciators
- Data-hold function
- Low battery indication
- Capacitance measurement
- Frequency measurement
- Auto power off

Accessories:

Test lead, battery [6F22(9V)x1], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	400m-500V	±(0.8%+2)
ACV	4-500V	±(1.2%+2)
OHM	400-40M Ω	±(2.0%+2)
FREQ	99.99Hz~9.999MHz	±(2.0%+3)
Size/Weight	120x79x18 mm/150g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	2000m-2-20-200-1000V	±0.5%
ACV	2-20-200-750V	±1.2%
DCA	2 μ -200 μ -2m-20m-200m-2A-10A	±2.0%
ACA	200 μ -2m-20m-200m-2A-10A	±2.0%
OHM	200-2K-20K-200K-2M-2M Ω	±1.0%
Diode Check	2.8V/0.8mA	
hFE	Vce 3V Ib 10 μ A	
Size/Weight	186x88x33mm/295g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	2000m-2-20-200-1000V	±0.5%
ACV	200-2-20-200-750V	±1.2%
DCA	2m-20m-200m-10A	±1.2%
ACA	20m-200m-10A	±1.8%
OHM	200-2K-20K-200K-2M-20M-200M Ω	±1.0%
CAP	2000p-20n-200n-2 μ -20 μ F	±2.5%
Diode Check	3V/0.8mV	
hFE	Vce 3V Ib 10 μ A	
Size/Weight	173x87x40mm/300g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	400m-4-40-400-1000V	±0.5%
ACV	400m-4-40-400-750V	±1.0%
DCA	400 μ -4m-40m-200m-10A	±1.5%
ACA	400 μ -4m-40m-200m-10A	±2.0%
OHM	400-4K-40K-400K-4M-40M Ω	±0.8%
CAP	4n-40n-400n-4 μ -40 μ F-200 μ F	±5.0%
FREQ	40-400-4000-40K-400K-4M-30MHz	±0.8%
Diode Check	2.8V/1mV	
hFE	Vce 3V, Ib 10 μ A	
Size/Weight	189x91x31.5mm/487g(Including Holster)	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2-20-200-1000V	±0.1%
ACV	2-20-200-700V	±0.8%
DCA	2m-20m-200m-20A	±0.75%
ACA	20m-200m-20A	±1.2%
OHM	200-2K-20K-200K-2M-20M-200M Ω	±0.5%
CAP	2n-20n-200n-2 μ -2 μ -20 μ F	±2.5%
FREQ	10Hz-20KHz	±1.0%
Diode Check	3V/1mV	
hFE	Vce 3V, Ib 10 μ A	
Size/Weight	170x88x38mm/318g	



中国·人民电器集团
PEOPLE ELE. APPLIANCE GROUP CHINA

MULTIMETER

MULTIMETER



CM8601A

- 3 1/2digits LCD with a Max. Reading of 1999
- CAP Measurement from 0.1PF to 20mF
- Overload protection

Accessories:

Test lead, battery [6F 22(9V)x1], instruction manual

DT9207

- 3 1/2digits LCD with a Max. Reading of 1999

The LCD can be freely adjusted to 70* Max.

- Capacitance measurement
- Temperature measurement
- Auto power off
- Overload protection

Accessories:

Test lead, Temp, probe, battery [23A (12V)x1], instruction manual



EC8808B

- 3 1/2digits LCD with a Max. Reading of 1999
- 12 Versatile ranges for flexibility of sue
- Low battery indication
- Overload protection
- Overload protection

Accessories:

Battery [23A (12V)x1], instruction manual



CM8601A+

- 3 1/2digits LCD with a Max. Reading of 1999
- Measurement from 0.1pF to 20mF
- 200.0pF range with zero adjustment
- Overload protection

Accessories:

Test lead, battery [6F22 (9V)x1], instruction manual carrying case



3211D

- 3 1/2digits LCD with a Max. Reading of 1999
- Built-in TTL and CMOS logic tester
- Data-hold function
- Auto ranging
- Auto polarity indication
- Overload protection

Accessories:

Battery [6F22 (9V)x1], instruction manual



SPECIFICATIONS

Function	Measuring Range	Accuracy
CAP	200p-20n-200n-2 μ -20 μ -200 μ -	\pm 3.5%
	2000 μ -20mF	\pm 4.0%
Size/Weight	180x82x38mm/300g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2-20-200-600V	\pm 0.5%
ACV	200mV-2-20-200-600V	\pm 1.2%
DCA	2m-20m-200m-10A	\pm 1.2%
ACA	20m-200m-10A	\pm 1.2%
OHM	200-2K-20K-200K-2M-20M-200M Ω	\pm 0.8%
CAP	2n-20n-200n-2 μ -20 μ F	\pm 2.5%
Temperature	-400 $^{\circ}$ C~1000 $^{\circ}$ C	\pm 1.5%
Diode Check	2.8V/1mA	
hFE	Vce 3V, Ib 10 μ A	
Signal Output	186x86x33mm/275g	
Battery	6F22(9V)x1	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	2-20-200-750V	\pm 0.8%
ACV	2-20-200-750V	\pm 1.2%
DCA	200mA-2A	\pm 1.2%
ACD	200mA-2A	\pm 1.8%
OHM	2K-20K-200K-2K Ω	\pm 0.8%
Diode Check	2.8V/1mA	
hFE	Vce 3V, Ib 10 μ A	
Size/Weight	175x105x47mm/325g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
CAP	200P-2000P-200n-2 μ -	\pm 4.0%
	20 μ -200 μ -2000 μ -20mF	
Size/Weight	135x72x33mm/207g	

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2-20-200-500V	\pm 1.0%
ACV	2-20-200-500V	\pm 1.2%
DCA	200mA	\pm 1.5%
ACD	200mA	\pm 2.5%
OHM	200-2K-20K-200K-2M-20M Ω	\pm 1.0%
Logic tester	L<1.5V, H>3.5V	
Size/Weight	185x31x22mm/80g	



中国·人民电器集团
PEOPLE ELE. APPLIANCE GROUP CHINA

CLAMP METER

CLAMP METER



266

- 3 1/2digits LCD with a Max. Reading of 1999
- Data-hold function
- Low battery indication
- Audible continuity
- Plug-in insulation tester adapter 500VDC (optional)

Accessories:

Test lead, battery [6F 22(9V)x1], instruction manual carrying case

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	1000V	±0.8%
ACV	750V	±1.2%
ACA	200-1000A	±2.5%
OHM	200-20K Ω	±1.0%
	20M-2000M Ω (with 2621)	±4.0%
Size/Weight	230x70x37mm/310g	



266C

- 3 1/2digits LCD with a Max. Reading of 1999
- Data-hold function
- Temperature measurement
- Low battery indication
- Plug-in insulation tester adapter 500VDC(optional)

Accessories:

Test lead, battery [6F 22(9V)x1], instruction manual carrying case

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	200m-2-20-200-1000V	±0.8%
ACV	200-750V	±1.2%
ACA	20-200-100A	±2.5%
OHM	200-20K-2M Ω	±1.0%
	20M-2000M Ω (with 261)	±4.0%
Temperature	-40℃~750℃	±3.0%
Size/Weight	230x70x37mm/310g	



2017

- 3 1/2digits LCD with a Max. Reading of 1999
- Three functions in one unit: ACV, ACA & OHM
- Data-hold function

Accessories:

Test lead, battery [6F 22(9V)x1], instruction manual carrying case

SPECIFICATIONS

Function	Measuring Range	Accuracy
ACV	200-600V	±1.5%
ACA	200-600A	±2.0%
OHM	200 Ω	±1.2%
Clamp Size	33mm(Max)	
Size/Weight	208x90x40mm/290g	



2017A

- Large LCD display with a Max. Reading of 1999
- Three functions in one unit: ACV, ACA & OHM
- Resistance range provides audible continuity test
- Data-hold function

Accessories:

Test lead, battery [6F 22(9V)x1], instruction manual carrying case

SPECIFICATIONS

Function	Measuring Range	Accuracy
ACV	200-600V	±1.5%
ACA	200-600A	±2.0%
OHM	200 Ω	±1.2%
Clamp Size	33mm(Max)	
Size/Weight	208x90x40mm/290g	



2608

- 5 function in one unit
- Pointer lock device to freeze reading
- Overload protection

Accessories:

Test lead, battery [AA(1.5V)x1], instruction manual carrying case

SPECIFICATIONS

Function	Measuring Range	Accuracy
DCV	60V	±4.0%
ACV	150-300-600V	±4.0%
ACA	6-15-60-150-300A	±4.0%
OHM	Rx1K, Rx10K	±4.0%
Size/Weight	193x78x39mm/285g	



中国·人民电器集团
PEOPLE ELE. APPLIANCE GROUP CHINA

CLAMP METER



KT9030

- 3 1/2digits LCD with a Max. Reading of 1999
- Low battery indication
- Data-hold function
- Auto-hold function
- Overload protection
- Audible continuity

Accessories:

Test lead, battery [6F 22(9V)x1], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
ACV	200-500V	± 1.2%
ACA	200-400A	± 2.0%
OHM	20K Ω	± 1.0%
Clamp Size	20mm(Max.)	
Size/Weight	175x43x29mm/200g	



KT9030B

- 3 1/2digits LCD with a Max. Reading of 1999
- Low battery indication
- Data-hold function
- Overload protection
- Audible continuity

Accessories:

Test lead, battery [6F 22(9V)x1], instruction manual

SPECIFICATIONS

Function	Measuring Range	Accuracy
ACV	500V	± 1.2%
ACA	400A	± 1.5%
Diode Check	2.8V/1mA	
Clamp Size	20mm(Max.)	
Size/Weight	175x43x29mm/200g	



MG26+

- Pocket size and light weight
- Versatility of use with ACV & ACA measurement
- Overload protection

Accessories:

Test lead, battery [6F 22(9V)x1], instruction manual carrying case

SPECIFICATIONS

Function	Measuring Range	Accuracy
ACV	0-300-600V	± 5.0%
ACA	0-5-10-25-100-250A	± 5.0%
Battery Check	1.5V	
Clamp Size	φ 28mm(Max.)	
Size/Weight	160x80x32mm/250g	

METER DETECTOR



TS-75 2 IN 1

Metal, Voltage

- The detector can test location of metal and electrified wire inside wall
- The detector will shine and sounds when the detector test metal or electrified wire.

SPECIFICATIONS

Function	Measuring Range
Metal Detector	Depth up to 25mm(φ 15mm steel pipe)
Voltage Detector	Depth up to 30mm(AC110V)
Detector	Depth up to 40mm(AC220V)
Ambient Condition	-20℃~+60℃, Below 30-80%RH
Size/Weight	150x78x24mm/110g
Battery	6F22(9V)x1



TS-78 3 IN 1

Metal, Voltage, Stud

- The detector can test location of metal, wood and electrified wire inside wall
- The detector will shine and sounds when the detector test metal or electrified wire.

SPECIFICATIONS

Function	Measuring Range
Metal Detector	Depth up to 25mm(φ 15mm steel pipe)
Voltage Detector	Depth up to 30mm(AC110V)
Detector	Depth up to 35mm(AC220V)
Stud Detector	Depth up to 20mm
Ambient Condition	-20℃~+60℃, Below 30-80%RH
Size/Weight	150x78x24mm/110g
Battery	6F22(9V)x1



中国·人民电器集团
PEOPLE ELE. APPLIANCE GROUP CHINA

HOUR

HOUR METER



SPECIFICATOINS


Item NO .	SYS
SupplyVoltage	DC12~36V,30~60V
Dimensions	54×32×58.5mm
Time Range	0~9999.9Hours
Net Weight	50g

1. This products is suitable for usage of House,Industry, Air condition,etc.
2. Time setting range available from 0 to 9999.9Hours

Item NO .	SYS
SupplyVoltage	DC12~36V,30~60V
Dimensions	54×32×58.5mm
Time Range	0~9999.9Hours
Net Weight	50g

1. This products is suitable for usage of House,Industry, Air condition,etc.
2. Time setting range available from 0 to 99,999.99Hours.
3. Accessories part H-C A dapter 72×72.

DIMENSIONS(mm)

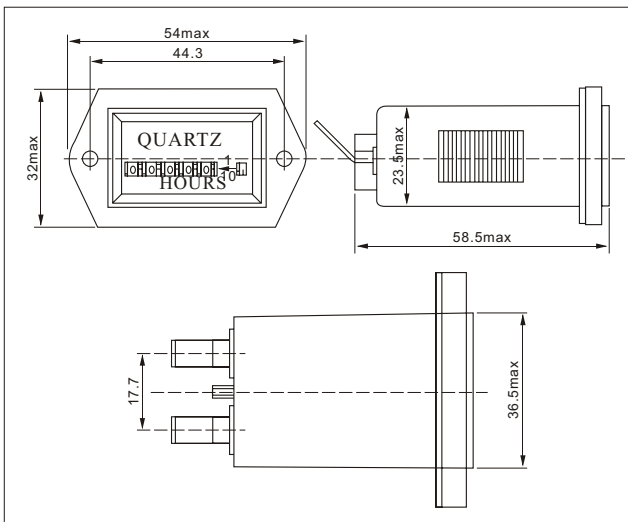

DIMENSIONS(mm)

